

Measured Data

QC Limits

Line	Parameter	Value	Units
1	RMSE-free	0.57	Ohms
2	Fs	35.51	Hz
3	Re	4.01	Ohms[dc]
4	Res	64.91	Ohms
5	Qms	7.81	
6	Qes	0.48	
7	Qts	0.45	
8	L1	1.05	mH
9	L2	1.16	mH
10	R2	5.47	Ohms
11	RMSE-load	0.44	Ohms
12	Vas(Sd)	259.82	liters
13	Mms	163.04	grams
14	Cms	123	$\mu\text{M}/\text{Newton}$
15	Bl	17.38	Tesla-M
16	SPLref(Sd)	95.7	dB[Re]
17	Rub-index	0.00	

Method: Mass-loaded (120.00 grams)

Area (Sd): 1225.42 sq cm


DCR mode: Measure (-0.12 ohms)

QC file: CLOSED

Analysis successful. Shift in Fs = -22.1% (-20% to -50% is recommended).

18PS100/4

MLSSA: Parameters

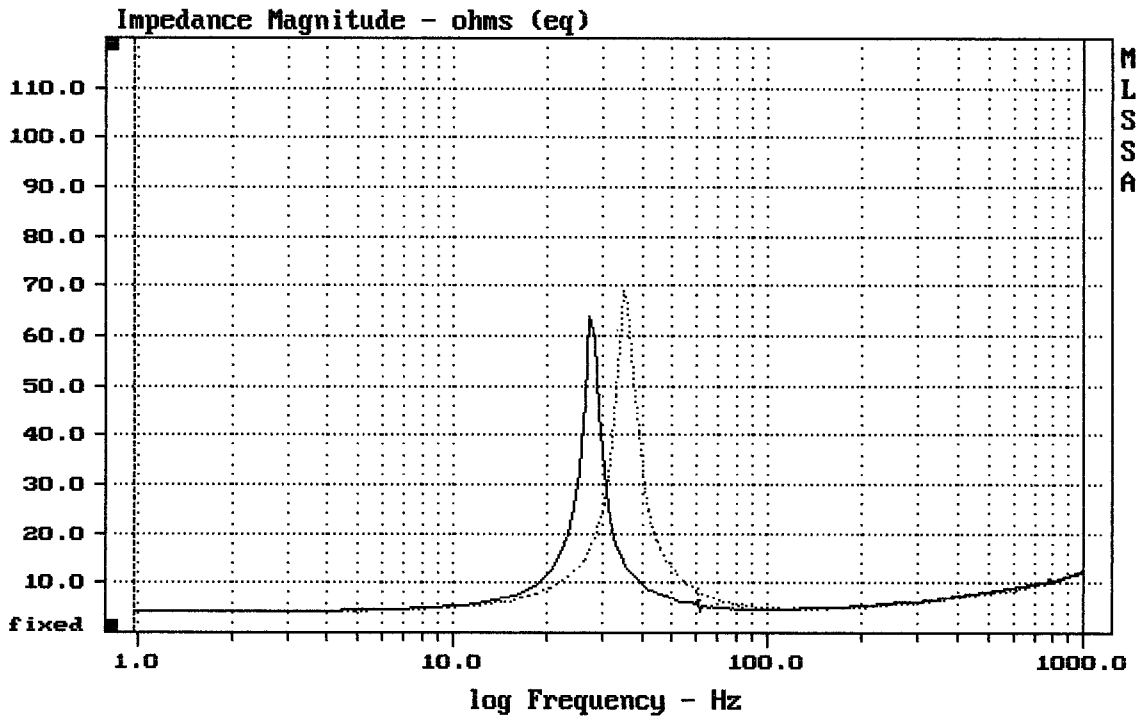

mean: 8.714, rms: 10.01, std: 4.935, max: 69.12, min: 4.11

MLSSA: Frequency Domain